

Lincolnshire County Council Section 19 Investigations - Network North Area H - Contact Officer Dean Myhill - Area Highways Manager						Identified Actions/Works				
Date of Incident	Town & Location	Description of Flooding	Risk Management Authorities with Responsibilities and whether they are exercising functions	Actions and Recommendations	Consideration for inclusion in future Common Works Programme	Proposed Action/Works	Promoter	Status	Estimated Timescales Recommendation Scheme Completion	S19 Report File Reference
28/06/2012	<b>Chapel St Leonards</b> Fairfield Avenue	Surcharging of Anglian Water surface water system due to displaced pipe work, and possible concerns over capacity.  <b>1 Property</b>	Anglian Water - <b>Yes</b>	AW to complete repair works to the displaced pipework.  It is recommended that AW carry out further work to ascertain the existing capacities of the system and if any further mitigation measure is required.	No	All recommended works completed Nov 2013	LCC	Complete	Complete Winter 2013	S19-013
28/06/2012	<b>Saltfleet</b> Main Road	Soil and vegetable matter washing into the channel in front of the property causing blockage to the adjacent gully.  <b>1 Property</b>	LCC - <b>Yes</b>	LCC to carry out work to trim and harden the verge to prevent future siltation and blockages of the channel and gully.	No	Works completed Nov 2013	LCC	Complete	Complete Winter 2013	S19-014
29/06/2012	<b>Saltfleet</b> Pump Lane	Overland and highway surface water flows entering low lying property due to collapsed and silted surface water drainage system.  <b>1 Property</b>	East Lindsey District Council - <b>Yes</b>	ELDC has investigated the surface water system and installed a new manhole enabling access, and will cleanse and repair the current system. This will include installing new gullies.	No	All work completed Nov 2013	ELDC	Complete	Complete Winter 2013	S19-015
28/06/2012	<b>Goulceby</b> Shop Lane	Overland flows from the adjacent hillside and agricultural land has been exacerbated by the overgrown/silted interceptor ditch, and the inlet to the culvert system being restricted by debris and silt. The combined flows caused flooding to a property opposite which is lower than the restricted culvert/ditch system.  <b>1 Property</b>	LCC - <b>Yes</b>	During and following the incident, the ditch underwent some clearance work by the resident of the flooded property. Witham 3rd IDB to ensure regular effective maintenance to the riparian ditch to the north of Shop Lane.	No	All works completed Nov 2013	Witham 3rd IDB LCC	Complete	Complete Winter 2013	S19-020
06/07/2012	<b>Huttoft</b> Mumby Road	Overland and highway surface water flows entering low lying property due to suspected lack of capacity in the surrounding highway drainage system.  <b>1 Property</b>	LCC - <b>Yes</b>	LCC have investigated the drainage system and will raise kerbs and install new gullies. LCC is awaiting funding availability prior to carrying out the works.	No	LCC to install new gullies and raised kerbs	LCC	Complete	Complete Sept 2013	S19-023
03/08/2012	<b>Mumby</b> Coots Lane	Following intense rainfall, water flowed down Coots Lane entering a property which is situated at the lowest point. A combination of water from the carriageway and driveway was believed to be the cause.  <b>1 Property</b>	LCC - <b>Yes</b> Lindsey Marsh IDB - <b>Yes</b>	Drainage survey to be undertaken with a view to upgrading the existing highway surface water drainage system. LMIDB to contact riparian land owner of the dyke to request it to be cleaned/maintained on a regular basis.	No	LCC to undertake drainage survey. LMIDB to request cleansing/maintenance of dyke.	LCC LMIDB	Complete	Summer 2014	S19-028

Lincolnshire County Council Section 19 Investigations - Network North Area H - Contact Officer Dean Myhill - Area Highways Manager						Identified Actions/Works				
Date of Incident	Town & Location	Description of Flooding	Risk Management Authorities with Responsibilities and whether they are exercising functions	Actions and Recommendations	Consideration for inclusion in future Common Works Programme	Proposed Action/Works	Promoter	Status	Estimated Timescales Recommendation Scheme Completion	S19 Report File Reference
09/06/2014	Louth Mayfield Crescent	Following torrential rain, the highway drains were unable to cope with the amount of surface water on the carriageway. Surface water was reported to have entered two low lying properties. After further investigation and confirmation from the local residents, flooding only affected the garages of the two properties.  <b>2 Properties</b>	LCC - Yes	LCC Highways may carry out maintenance work in the future although it is not classed as a priority as living accommodation was not flooded on this occasion. LCC have informed the residents that resilience measures to their property would be beneficial.	No	Residents advised to undertake resilience measures to protect their properties. LCC Highways to look at highway improvements in the future if required.	LCC	Complete	Complete Autumn 2014	S19-097